

MaxCS 8.0 and 8.5 Polycom Firmware 5.5.1 Rev Q Update

MaxCS 8.0 and 8.5 now support Polycom firmware 5.5.1 Rev Q for VVX model phones.

This document provides steps for upgrading firmware for Polycom phones that have already been deployed. It also includes other Polycom operational notes.

 
Updating Polycom Phones to Firmware 5.5.1 Rev Q

AltiGen recommends that you follow these procedures to update your organization's Polycom VVX phones to firmware version 5.5.1:

- 1. If you want to disable the firmware auto-upgrade feature, in order to roll out the firmware change on a specific timeline, follow these steps:
 - a. In MaxCS Administrator, select **System > Polycom Configuration**.
 - b. Clear the Upgrade VVX Firmware to... option.



- c. Select **PBX > AltiGen IP Phone Configuration**. Switch to the **Polycom** tab.
- d. Select a Polycom extension and clear the *Upgrade firmware to...* option in the *VVX* section. Repeat for each Polycom extension.





2. Download firmware version 5.5.1 Rev Q (Split) from the Polycom website:

http://downloads.polycom.com/voice/voip/uc_sw_releases_matrix.html

Polycom UC Software Release Matrix For VVX Phones

The Polycom SoundPoint IP (SPIP) and SoundStation IP (SSIP) Software Release Matrix can be found here.

Release	Release Notes	VVX 101	VVX 201	VVX 300/310	VVX 301/311	VVX 400/410	VVX 401/411	VVX 500	VVX 501	VVX 600	VVX 601
5.5.2 Combined	View	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Yes
5.5.2 Split	view	103	163	les	les	168	165	105	103	103	163
5.5.1 Rev Q Combined	View 2	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Yes
5.5.1 Rev Q Split											
5.5.1 Rev P Combined	View	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Yes
5.5.1 Rev P Split											

Extract all of the files to this folder on the MaxCS server: \AltiServ\PolyComFW\VVX

3. When you are ready to push the new firmware to some or all Polycom phones, in MaxCS Administrator select **System > Polycom Configuration** and check the *Upgrade VVX Firmware to...* option.

Then, for the specific phones that you want to upgrade, select **PBX** > **AltiGen IP Phone Configuration** and switch to the **Polycom** tab. Select the Polycom extension and check the *Upgrade firmware to...* option. The firmware will download to the phone the next time the
phone is rebooted. (To force the phone to reboot immediately, click **Save and Reboot Polycom Phone**.)

Enhancements Included with Firmware 5.5.1 Rev Q

The following VVX features are now supported with firmware 5.5.1 Rev Q:

- BLF
- Line Park

Operational Notes

- MaxCS now supports these additional VVX models:
 - VVX 301/311
 - o VVX 401/411
 - o VVX 501
 - o VVX 601



- When a user performs a long-press transfer (holding down the Transfer button for several seconds),
 a Blind (Unattended) transfer is performed immediately. This is a change from previous releases,
 where the user was offered a choice before the transfer was initiated.
- The VVX phone will not support the Do Not Disturb (DND) feature if the user has connected a D60 handset with the phone.